

New Hampshire Volunteer Lake Assessment Program

2003 Biennial Report for Reservoir Pond Lyme



NHDES
Water Division
Watershed Management Bureau
29 Hazen Drive
Concord, NH 03301



OBSERVATIONS & RECOMMENDATIONS

After reviewing data collected from **RESERVOIR POND, LYME**, the program coordinators have made the following observations and recommendations:

We would like to thank your group for sampling your pond once this summer. However, we would like to encourage your monitoring group to sample additional times each summer. Typically we recommend that monitoring groups sample three times per summer (once in June, July, and August). We understand that the number of sampling events you decide to conduct per summer will depend upon volunteer availability, your monitoring group's water monitoring goals and funding availability. However, with a limited amount of data it is difficult to determine accurate and representative water quality trends. Since weather patterns and activity in the watershed can change throughout the summer, from year to year, and even from hour to hour during a rain event, it is a good idea to sample the pond at least once per month over the course of the season.

If you are having difficulty finding volunteers to help sample, or to pick-up or drop-off equipment at one of the laboratories, please give the VLAP Coordinator a call and we will try to help you work out an arrangement.

FIGURE INTERPRETATION

- **Figure 1 and Table 1:** The graphs in Figure 1 (Appendix A) show the historical and current year chlorophyll-a concentration in the water column. Table 1 (Appendix B) lists the maximum, minimum, and mean concentration for each sampling season that the pond has been monitored through the program.

Chlorophyll-a, a pigment naturally found in plants, is an indicator of the algal abundance. Because algae are usually microscopic plants that contain chlorophyll-a, and are naturally found in lake ecosystems, the chlorophyll-a concentration measured in the water gives an estimation of the algal concentration or lake productivity.

The mean (average) summer chlorophyll-a concentration for New Hampshire's lakes and ponds is 7.02 mg/m³.

The current year data (the top graph) show that the chlorophyll-a concentration in July was **less than** the state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) shows **a decreasing** in-lake chlorophyll-a trend, meaning that the concentration has **improved** since monitoring began. However, this is based on limited data. After 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historic data to objectively determine if there has been a significant change in the annual mean chlorophyll-a concentration since monitoring began.

While algae are naturally present in all lakes/ponds, an excessive or increasing amount of any type is not welcomed. In freshwater lakes/ponds, phosphorus is the nutrient that algae depend upon for growth. Algal concentrations may increase with an increase in nonpoint sources of phosphorus loading from the watershed, or in-lake sources of phosphorus loading (such as phosphorus releases from the sediments). Therefore, it is extremely important for volunteer monitors to continually educate residents about how activities within the watershed can affect phosphorus loading and pond quality.

- **Figure 2 and Table 3:** The graphs in Figure 2 (Appendix A) show historical and current year data for pond transparency. Table 3 (Appendix B) lists the maximum, minimum and mean transparency data for each sampling season that the pond has been monitored through the program.

Volunteer monitors use the Secchi-disk, a 20 cm disk with alternating black and white quadrants, to measure water clarity (how far a person can see into the water). Transparency, a measure of water clarity, can be affected by the amount of algae and sediment from erosion, as well as the natural colors of the water. **The mean (average) summer transparency for New Hampshire's lakes and ponds is 3.7 meters.**

The current year data (the top graph) show that the in-lake transparency in July was **approximately equal to** the state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) shows **a stable** trend for in-lake transparency, meaning that the transparency has **remained approximately the same** since monitoring began. However, this is based on limited data. After 10

consecutive years of sample collection, we will be able to conduct a statistical analysis of the historic data to objectively determine if there has been a significant change in the annual mean transparency since monitoring began.

Typically, high intensity rainfall causes erosion of sediments into lakes/ponds and streams, thus decreasing clarity. Efforts should continually be made to stabilize stream banks, pond shorelines, disturbed soils within the watershed, and especially dirt roads located immediately adjacent to the edge of tributaries and the pond. Guides to Best Management Practices designed to reduce, and possibly even eliminate, nonpoint source pollutants, such as sediment loading, are available from DES upon request.

- **Figure 3 and Table 8:** The graphs in Figure 3 (Appendix A) show the amounts of phosphorus in the epilimnion (the upper layer) and the hypolimnion (the lower layer); the inset graphs show current year data. Table 8 (Appendix B) lists the annual maximum, minimum, and median concentration for each deep spot layer and each tributary since the pond has joined the program.

Phosphorus is the limiting nutrient for plant and algae growth in New Hampshire's freshwater lakes and ponds. Too much phosphorus in a pond can lead to increases in plant and algal growth over time. **The median summer total phosphorus concentration in the epilimnion (upper layer) of New Hampshire's lakes and ponds is 11 ug/L. The median summer phosphorus concentration in the hypolimnion (lower layer) is 14 ug/L.**

The current year data for the epilimnion (the top inset graph) and the hypolimnion (the bottom inset graph) show that the phosphorus concentration in July was **less than** the state median.

Overall, visual inspection of the historical data trend line for the epilimnion shows a **variable** phosphorus trend, which means that the concentration has **fluctuated** in the epilimnion since monitoring began.

Overall, visual inspection of the historical data trend line for the hypolimnion shows **an increasing** phosphorus trend, which means that the concentration has **worsened** in the hypolimnion since monitoring began.

Visual inspection of the trend line for the epilimnion and hypolimnion is based on limited data. After 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the

historic data to objectively determine if there has been a significant change in the annual mean phosphorus concentration since monitoring began.

One of the most important approaches to reducing phosphorus loading to a waterbody is to continually educate watershed residents about its sources and how excessive amounts can adversely impact the ecology and value of lakes and ponds. Phosphorus sources within a lake or pond's watershed typically include septic systems, animal waste, lawn fertilizer, road and construction erosion, and natural wetlands.

TABLE INTERPRETATION

➤ **Table 2: Phytoplankton**

Table 2 (Appendix B) lists the current and historic phytoplankton species observed in the pond. The dominant phytoplankton species observed this year were ***Dinobryon* (a golden-brown), *Staurastrum* (a green), and *Chrysosphaerella* (a golden-brown).**

Phytoplankton populations undergo a natural succession during the growing season (Please refer to the “Biological Monitoring Parameters” section of this report for a more detailed explanation regarding seasonal plankton succession). Diatoms and golden-brown algae are typical in New Hampshire's less productive lakes and ponds.

An overabundance of cyanobacteria (blue-green algae) indicates that there may be an excessive total phosphorus concentration in the pond, or that the ecology is out of balance. Some species of cyanobacteria can be toxic to livestock, pets, wildlife, and humans. (Please refer to the “Biological Monitoring Parameters” section of this report for a more detailed explanation regarding cyanobacteria).

Residents should observe the pond in September and October during the time of fall turnover (lake mixing) to document any algal blooms that may occur. Cyanobacteria (blue-green algae) have the ability to regulate their depth in the water column by producing or releasing gas from vesicles. However, occasionally lake mixing can affect their buoyancy and cause them to rise to the surface and bloom. Wind and currents tend to “pile” cyanobacteria into scums that accumulate in one section of the pond. If a fall bloom occurs, please contact the VLAP Coordinator.

➤ **Table 4: pH**

Table 4 (Appendix B) presents the in-lake and tributary current year and historical pH data.

pH is measured on a logarithmic scale of 0 (acidic) to 14 (basic). pH is important to the survival and reproduction of fish and other aquatic life. A pH below 5.5 severely limits the growth and reproduction of fish. A pH between 6.5 and 7.0 is ideal for fish. The mean pH value for the epilimnion (upper layer) in New Hampshire's lakes and ponds is **6.5**, which indicates that the surface waters in state are slightly acidic. For a more detailed explanation regarding pH, please refer to the "Chemical Monitoring Parameters" section of this report.

The mean pH at the deep spot this season ranged from **5.77** in the hypolimnion to **6.40** in the epilimnion, which means that the water is **slightly acidic**.

Due to the presence of granite bedrock in the state and the deposition of acid rain, there is not much that can be done to effectively increase pond pH.

➤ **Table 5: Acid Neutralizing Capacity**

Table 5 (Appendix B) presents the current year and historic epilimnetic ANC for each year the pond has been monitored through VLAP.

Buffering capacity or ANC describes the ability of a solution to resist changes in pH by neutralizing the acidic input to the lake. The mean ANC value for New Hampshire's lakes and ponds is **6.7 mg/L**, which indicates that many lakes and ponds in the state are "highly sensitive" to acidic inputs. For a more detailed explanation, please refer to the "Chemical Monitoring Parameters" section of this report.

The Acid Neutralizing Capacity (ANC) of the epilimnion (the upper layer) continues to remain ***much less than*** the state mean of **6.7 mg/L**. Specifically, the pond is classified by DES as ***critically sensitive*** to acidic inputs (such as acid precipitation).

➤ **Table 6: Conductivity**

Table 6 (Appendix B) presents the current and historic conductivity values for tributaries and in-lake data. Conductivity is the numerical expression of the ability of water to carry an electric current. The mean conductivity value for New Hampshire's lakes and ponds is **62.1 uMhos/cm**. For a more detailed explanation, please refer to the

“Chemical Monitoring Parameters” section of this report.

The conductivity in the pond is relatively **low** and **less than** the state mean. Typically conductivity levels greater than 100 uMhos/cm indicate the influence of human activities on surface water quality. These activities include septic system leachate, agricultural runoff, iron deposits, and road runoff (which contains road salt during the spring snow melt). The low conductivity level in the **pond** is an indication of the low amount of pollutants in the watershed. We hope this trend continues!

The conductivity has **increased** in **Townline Brook** since monitoring began. Typically, sources of increased conductivity are due to human activity. These activities include septic systems that fail and leak leachate into the groundwater (and eventually into the tributaries and the pond), agricultural runoff, and road runoff (which contains road salt during the spring snow melt). New development in the watershed can alter runoff patterns and expose new soil and bedrock areas, which could contribute to increasing conductivity. In addition, natural sources, such as iron deposits in bedrock, can influence conductivity.

We recommend that your monitoring group conduct stream surveys and storm event sampling along the inlet(s) with elevated conductivity so that we can determine what may be causing the increases.

For a detailed explanation on how to conduct rain event and stream surveys, please refer to the 2002 VLAP Annual Report “Special Topic Article”, or contact the VLAP Coordinator.

➤ **Table 8: Total Phosphorus**

Table 8 (Appendix B) presents the current year and historic total phosphorus data for in-lake and tributary stations. Phosphorus is the nutrient that limits the algae’s ability to grow and reproduce. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation.

The total phosphorus concentration in the **Townline Brook** was elevated on **7/16/03**. The turbidity (Table 11) of the sample was also elevated, which suggests that the stream bottom may have been disturbed while sampling or that erosion is occurring in this portion of the watershed. Erosion is likely since it was estimated that between 0.5 to 1.0 inches of rain fell within the previous 24 hours.

When the stream bottom is disturbed, sediment, which typically contains attached phosphorus, is released into the water column. When collecting samples in the inlets, please be sure to sample where

there the stream is flowing and where the stream is deep enough to collect a “clean” sample.

If you suspect that erosion is occurring in this portion of the watershed, we recommend that your monitoring group conduct stream surveys and storm event sampling along this inlet. This additional sampling may allow us to determine what is causing the elevated levels of turbidity and phosphorus.

For a detailed explanation on how to conduct rain event and stream surveys, please refer to the 2002 VLAP Annual Report “Special Topic Article”, or contact the VLAP Coordinator.

➤ **Table 9 and Table 10: Dissolved Oxygen and Temperature Data**

Table 9 (Appendix B) shows the dissolved oxygen/temperature profile(s) for the 2003 sampling season. Table 10 (Appendix B) shows the historical and current year dissolved oxygen concentration in the hypolimnion (lower layer). The presence of dissolved oxygen is vital to fish and amphibians in the water column and also to bottom-dwelling organisms. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation.

The dissolved oxygen concentration was **high** at all depths sampled at the deep spot of the pond. As stratified lakes/ponds age, oxygen becomes **depleted** in the hypolimnion (lower layer) by the process of decomposition. Specifically, the loss of oxygen in the hypolimnion results primarily from the process of biological oxidation of organic matter (i.e.; biological organisms using oxygen to break down organic matter), both in the water column and particularly at the bottom of the pond where the water meets the sediment. The **high** oxygen level in the hypolimnion is a sign of the pond’s overall good health.

➤ **Table 11: Turbidity**

Table 11 (Appendix B) lists the current year and historic data for in-lake and tributary turbidity. Turbidity in the water is caused by suspended matter, such as clay, silt, and algae. Water clarity is strongly influenced by turbidity. Please refer to the “Other Monitoring Parameters” section of this report for a more detailed explanation.

The turbidity in the **Townline Brook** sample was elevated on **7/16/03**, which suggests that the stream bottom may have been disturbed while sampling or that erosion is occurring in this portion of the watershed. Erosion is likely since it was estimated that between 0.5 to 1.0 inches of rain fell within the previous 24 hours.

When the stream bottom is disturbed, sediment, which typically contains attached phosphorus, is released into the water column. When collecting samples in the inlets, please be sure to sample where there the stream is flowing and where the stream is deep enough to collect a “clean” sample.

If you suspect that erosion is occurring in this portion of the watershed, we recommend that your monitoring group conduct stream surveys and storm event sampling along this inlet. This additional sampling may allow us to determine what is causing the elevated levels of turbidity. The DES biologist noted that erosion from dirt roadways may have caused the elevated turbidity readings. DES strongly encourages implementation of Best Management Practices (BMPs) to reduce or eliminate sources of non point pollution such as dirt from roadways from entering the pond.

For a detailed explanation on how to conduct rain event and stream surveys, please refer to the 2002 VLAP Annual Report “Special Topic Article”, or contact the VLAP Coordinator.

NOTES

- **Monitor’s Note (7/16/03):** Cutter inlet dry so no sample taken. Townline Inlet was milky (turbid) due to rain event; likely runoff from dirt road. Sampling conducted during a rain event, with approx. 0.5” of rain prior to sampling.
- **Biologist’s Note (7/16/03):** The phosphorous level at Townline Brook was high.

USEFUL RESOURCES

Acid Deposition Impacting New Hampshire's Ecosystems, ARD-32, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/ard/ard-32.htm.

Best Management Practices to Control Nonpoint Source Pollution: A Guide for Citizens and Town Officials, NHDES-WD 97-8, NHDES Booklet, (603) 271-3503.

Camp Road Maintenance Manual: A Guide for Landowners. Kennebec Soil and Water Conservation District, 1992, (207) 287-3901.

Comprehensive Shoreland Protection Act, RSA 483-B, WD-SP-5, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/sp/sp-5.htm.

Cyanobacteria in New Hampshire Waters Potential Dangers of Blue-Green Algae Blooms, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/wmb/wmb-10.htm.

Erosion Control for Construction in the Protected Shoreland Buffer Zone, WD-SP-1, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/sp/sp-1.htm

Is it Safe to Eat the Fish We Catch? Mercury and Other Pollutants in Fish, NH Department of Health and Human Services pamphlet, 1-800-852-3345, ext. 4664.

Lake Protection Tips: Some Do's and Don'ts for Maintaining Healthy Lakes, WD-BB-9, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-9.htm.

Management of Canada Geese in Suburban Areas: A Guide to the Basics, Draft Report, NJ Department of Environmental Protection Division of Watershed Management, March 2001, www.state.nj.us/dep/watershedmgt/DOCS/BMP_DOCS/Goosedraft.pdf.

Proper Lawn Care In the Protected Shoreland, The Comprehensive Shoreland Protection Act, WD-SP-2, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/sp/sp-2.htm.

Road Salt and Water Quality, WD-WMB-4, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/wmb/wmb-4.htm.

Sand Dumping - Beach Construction, WD-BB-15, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-15.htm.

Through the Looking Glass: A Field Guide to Aquatic Plants. North American Lake Management Society, 1988, (608) 233-2836 or www.nalms.org.



Weed Watchers: An Association to Halt the Spread of Exotic Aquatic Plants, WD-BB-4, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-4.htm.

APPENDIX A

GRAPHS



Reservoir Pond, Lyme

Figure 1. Monthly and Historical Chlorophyll-a Results

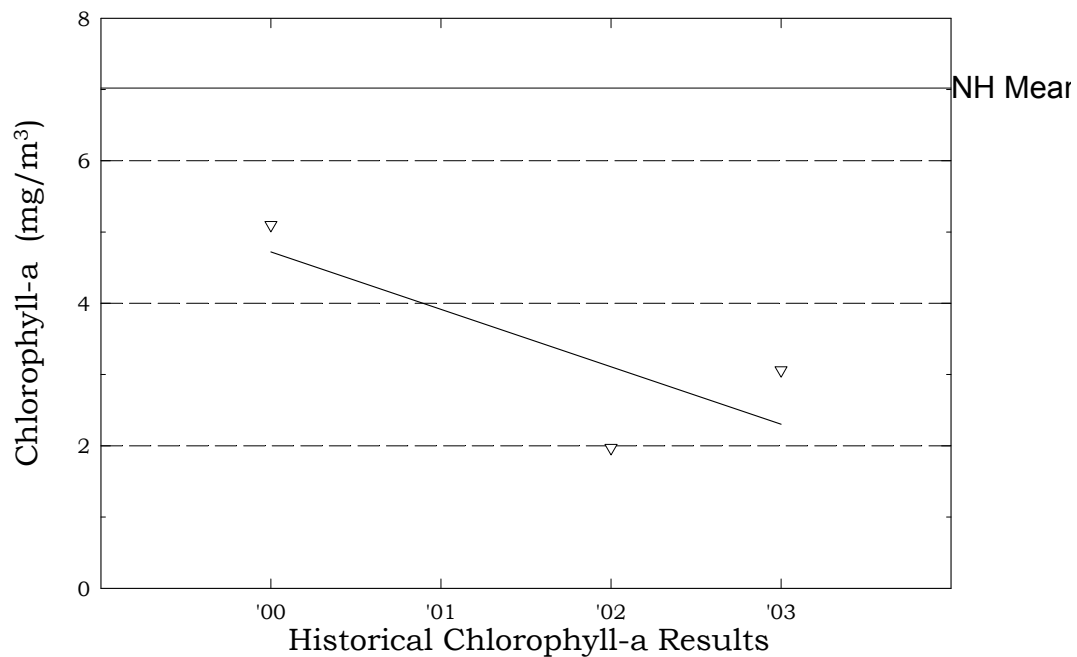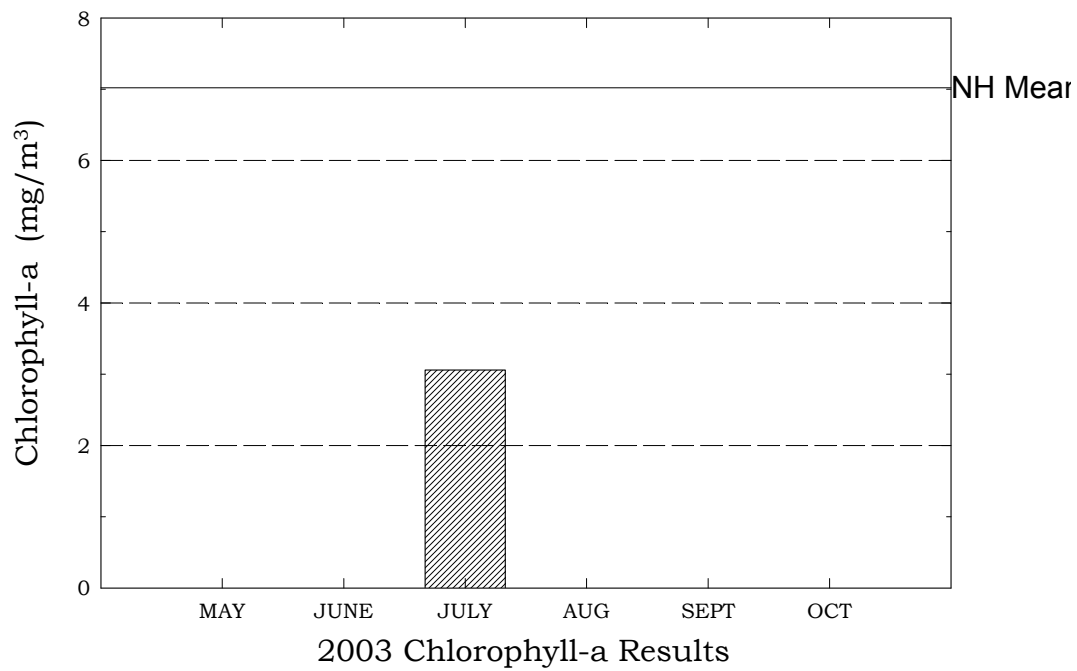

Reservoir Pond, Lyme

Figure 2. Monthly and Historical Transparency Results

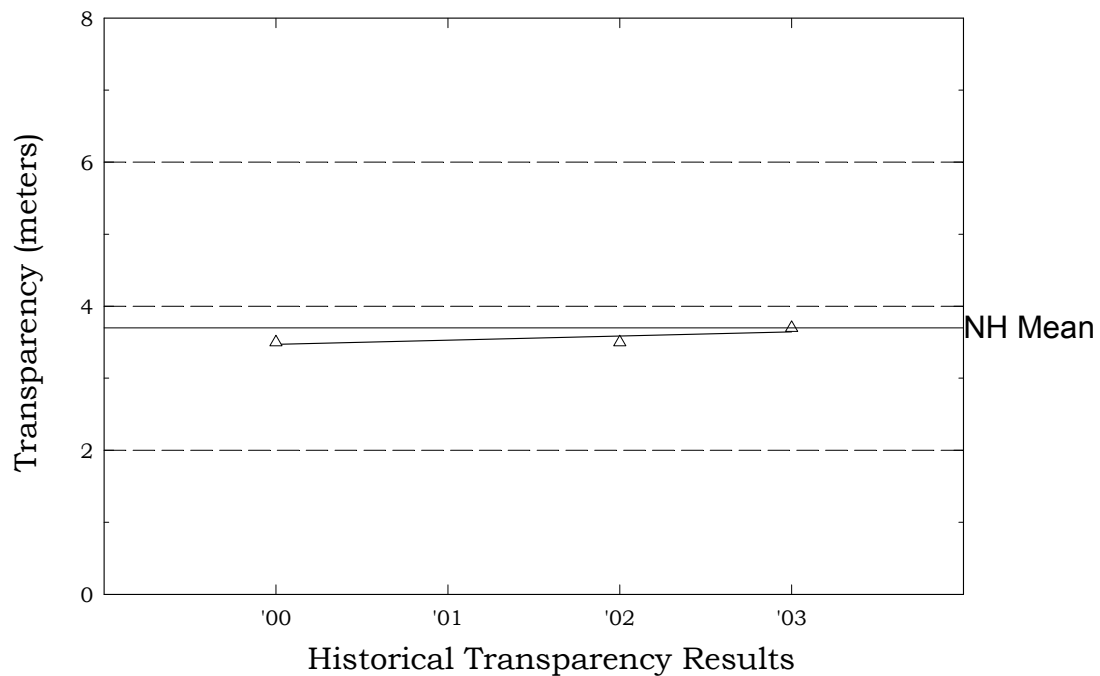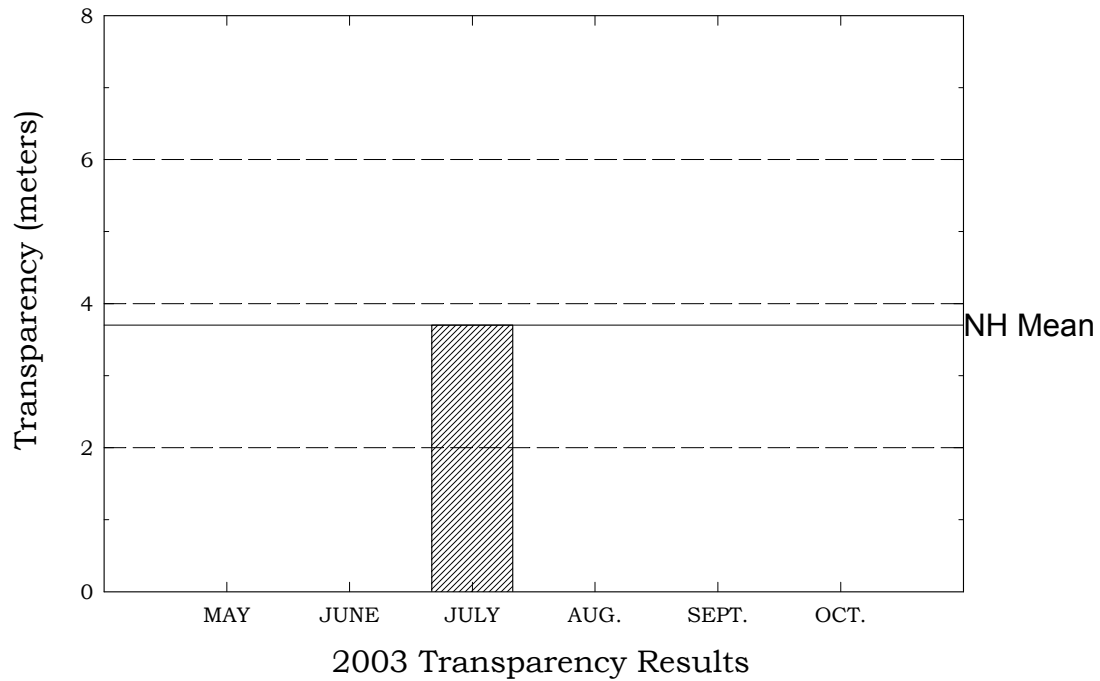

Reservoir Pond, Lyme

Figure 3. Monthly and Historical Total Phosphorus Data.

